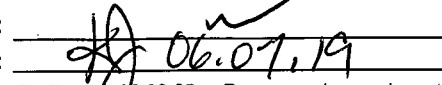
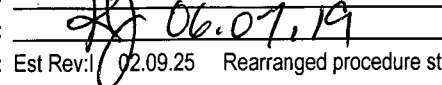


Date: Tuesday, 7/18/2006 2:55:52 PM  
 User: Kim Johnston

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services  
 Job Number : 27958  
 Estimate Number : 10265  
 P.O. Number : N/A  
 This Issue : 7/18/2006 S.O. No. : N/A  
 Prsht Rev. : NC  
 First Issue : N/A Type : LANDING GEAR  
 Previous Run : 27732  
 Written By :   
 Checked & Approved By :   
 Comment : Est Rev: 02-09-25 Rearranged procedure steps KJ  
 Est Rev: 06-03-29 As per Rev D EC  
 Est Rev: 06-07-13 As per dsi9343 EC

Drawing Name : 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW  
 Part Number : D350636012  
 Drawing Number : D2750 UNDER REVIEW  
 Project Number : N/A  
 Drawing Revision : D  
 Material : N/A  
 Due Date : 8/20/2006 Qty: 1 Um: Each

010  
06.07.19 AL

## Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
1.0	DC	DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy blue file and type labels per PPP D350-636-012 CHG 002

KS 06-07-27

2.0

D26003BENT

Extrusion Bent



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2600-3-Bent

Extrusion (Bent)

B26287

Pm 06-08-16

3.0

D2744

Fwd Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch:

B25839

BE 06-08-16

4.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Mark cut line on aft end of D2600-3-Bent using Jig DT 8150. Cut to length as per Dwg D2750. Deburr end

2-Drill pilot holes as per Dwg D2750 sheet 3 (D2750-1 details). Drill using drill Jig DT8150 &amp; DT8863 drilling holes labelled "A" only.

3- Mark fwd end for cutting using Drill Jig DT 8150 &amp; DT8863 and cut as per dwg D2750.

Pm  
06-08-16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Tuesday, 7/18/2006 2:55:52 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW

Job Number: 27958

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

4-Drill pilot holes for Detail B using DT8330

5-Drill pilot holes for wearplates as per Dwg D2750 using DT8108 and open to 0.250" \*\*\*Make sure that wearplate holes are on bottom of tube\*\*\*\*\*

6-Open up holes of Detail A to 0.250" (total of 2 holes per side)

7- Countersink all fwd wearshoe holes (total of 19 holes per side) DO NOT C'SINK THE LAST AFT HOLES (total of 2 per side for blade fitting) as per dwg D2750.

8-Countersink Detail A as per dwg D2750.

9-Weld D2744 Cap as per Dwg D2750 and QSI 004.Fill grooves in bend left from bending as per QSI 004  
A/R Aluminum Rod M100660 BE 06-08-16 (1)

10-Grind welds flush as per Dwg D2750

BE 06-08-16 (1)

BE 06-08-16 (1)

5.0

QC5/9

WELD INSPECTION



Comment: WELD INSPECTION

DP 6-8-17

MAG 08-16 (1)

6.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI.005 4.1

PM 06-08-16 (1)

7.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

DP 6-8-17

8.0

D2739

350 I Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Web

Batch: 527967 AT 06-08-22

9.0

D34901

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Crossbolt spacer

Batch: 527972 BE 06-08-23

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Tuesday, 7/18/2006 2:55:52 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW

Job Number: 27958

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

10.0

D34903

CROSS BOLT SPACER



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Crossbolt spacer

Batch: B27973

BE 06-08-23

11.0

D2743

Crossbolt Spacer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Crossbolt Spacer

Batch: B26208

BE 06-08-23

12.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open up holes for Detail B, "hole size W" and blade fitting location holes to 0.500" (total of 9 holes per side) as per dwg D2750.

2-Open up holes of Detail V & Detail C to 0.625" (total of 8 holes per side) as per dwg D2750.

3-Open up holes of Detail D to 0.750" (total of 4 holes per side) as per dwg D2750.

4-Chamfer holes of Detail V, Detail C, Detail D and hole size "W" per dwg D2750 (welding instructions on sheet 4)

5-Deburr and blow out all chips from inside of tube

6-Bond web D2739 in place as per QSI 015

A/R Sikaflex-291

batch: M101855 BT 06-08-22  
exp. date: 07-02-01

7- Weld spacers D3490-1, D3490-3 and D2743 as per dwg D2750 & QSI004 (welding instructions on sheet 4)

A/R

Aluminum Rod

batch: M101655 BE 06-08-23

8-Grind welds flush as per Dwg D2750

fm 06-08-23

9-Spot face ground handling holes section J-J (total of 4 places per side) as per dwg D2750

fm 06-08-23

10-Deburr holes

fm 06-08-23

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Tuesday, 7/18/2006 2:55:52 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW

Job Number: 27958

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC5/9

WELD INSPECTION



*06-08-24*

Comment: Inspect weld and work to Step 20

*PD 06-08-23*

14.0

POWDER COATING

POWDER COATING



*M101575*



Comment: POWDER COATING

Powder Coat Gloss White (Ref. 4.3.5.1) as per Dart QSI 005 4.3

*9/ 06/10/24 X1*

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect for foreign object per QSI 024

*Q-M 06/10/31*

16.0

ALS44032225

Insert



Comment: Qty.: 46.0000 Each(s)/Unit Total: 46.0000 Each(s)

Insert

Batch:

17.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts as per dwg D2750

*Q-M 06/10/31*

18.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Inserts

*FC 06 10 31*

19.0

D26483

Wearpad



Comment: Qty.: 5.0000 Each(s)/Unit Total: 5.0000 Each(s)

Wearpad

Batch: *027169*

20.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Wearplate

Batch: *027739*

*Q-M 06/10/31*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_



Date: Tuesday, 7/18/2006 2:55:52 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW

Job Number: 27958

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

21.0	D265635	Wearplate
------	---------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
Wearplate  
Batch: B26206

22.0	D2746	Wearshoe
------	-------	----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
Wearplate  
Batch: B27845

23.0	D2745	Bushing
------	-------	---------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)  
Bushing  
Batch: B27862

24.0	D3488042	BLADE FITTING ASSEMBLY, RH
------	----------	----------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)  
Blade Fitting, LH  
Batch: B26831

25.0	D3492041	PLUG ASSEMBLY
------	----------	---------------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)  
PLUG ASSEMBLY  
Batch: B29017

26.0	D3492043	PLUG ASSEMBLY
------	----------	---------------



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)  
PLUG ASSEMBLY  
Batch: B29024

am 06/10/31 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Tuesday, 7/18/2006 2:55:53 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW

Job Number: 27958

Part Number: D350636012

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

27.0	AN835A	Bolt
------	--------	------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)  
Bolt  
Batch: \_\_\_\_\_

28.0	AN960JD816	1/2" washer, Alum
------	------------	-------------------



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)  
Washer  
Batch: \_\_\_\_\_

29.0	MS21083N8	Nut
------	-----------	-----



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)  
Nut  
Batch: \_\_\_\_\_

30.0	AN960JD10L	Washer
------	------------	--------



Comment: Qty.: 42.0000 Each(s)/Unit Total: 42.0000 Each(s)  
washer  
Batch: \_\_\_\_\_

31.0	AN3C5A	Bolt
------	--------	------



Comment: Qty.: 38.0000 Each(s)/Unit Total: 38.0000 Each(s)  
Bolt  
Batch: M102472

32.0	AN3C6A	BOLT
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)  
Bolt  
Batch: M19522

33.0	AN3C7A	BOLT
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)  
BOLT  
Batch: M10124

a.m 06/10/31 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Tuesday, 7/18/2006 2:55:53 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW

Job Number: 27958

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

AN6C44A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

BOLT

Batch: M100736

35.0

AN8C35A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

BOLT

Batch: M102160

36.0

AN960C10L

washer



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

washer

Batch: M101340

37.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M100186

38.0

MS210436

NUT



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

NUT

Batch: M101537

39.0

MS21083C8

NUT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

NUT

Batch: M100186

40.0

NAS1330S3KB166

INSERT



Comment: Qty.: 42.0000 Each(s)/Unit Total : 42.0000 Each(s)

INSERT

Batch: M19349

a.m 06/10/37 (D)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Tuesday, 7/18/2006 2:55:53 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW

Job Number: 27958

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

41.0

NAS1515H3L

WASHER



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

WASHER

Batch: M101418

42.0

NAS1515H8L

WASHER



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

WASHER

Batch: M100157

43.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

FC 06-1021 ①

44.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Inspect for Foreign Objects

2-Spray inside of tube with "LPS-3"

batch: M101915

3-Install blade fitting D3488-042, wearshoes and ground handling hardware as per dwg D2750

SIKA FLEX 241

BATCH: M102107

EXP DATE: 02/07

4-Coat all exposed fasteners with "LPS Procyon"

batch: M17168

a.m 06/10/31 ①

45.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

46.0

D2741

Blade



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Blade

Batch: B27968 ✓

AB 06/11/01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_



Date: Tuesday, 7/18/2006 2:55:53 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW

Job Number: 27958

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

47.0

AN960C816L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: M100186

48.0

MS21083C8

NUT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Nut

Batch: M100186 ✓

49.0

AN8C21A

BOLT



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: M100262 ✓

50.0

NAS1515H8L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: M100187 ✓

51.0

D34931

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

WASHER

Batch: B27895 ✓

52.0

D35321

spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

spacer

Batch: B27894 ✓

53.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

*LB 06/11/01*  
*Aug 1/01*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ Date: 06/11/02

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

Date: Tuesday, 7/18/2006 2:55:53 PM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350 SKIDTUBE ASSEMBLY RH UNDER REVIEW

Job Number: 27958

Part Number: D350636012

Job Number:



Seq. #:

Machine Or Operation:

Description :

54.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Package as per PPP D350-636-012

*REV E*

*Refer to 1*

55.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Inspection Level 21

*2006/11/100*

Job Completion



*u 2011.01*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Mfg / Design Mgr	Approval QC Inspector

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Design Mgr	Approval QC Inspector
			Initial Design Mgr	Action Description Design Mgr	Sign & Date			

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

NOTE: Date & initial all entries

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_



DESIGN <i>PH</i>	DRAWN BY <i>PH</i>	<b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
CHECKED <i>PH</i>	APPROVED <i>PH</i>	DRAWING NO. D2750	REV. D SHEET 1 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY SCALE NTS	
A	98.04.16	NEW ISSUE	
B	98.09.01	CHANGE MS24694-S293 TO AN8-16A	
C	98.11.18	ADD D2750-3/D2750-4 INCORPORATE D2738 AND D2740	
D	06.01.05	ADD HOLES AND SPACERS FOR APICAL FLOATS INCORPORATE DEO 9133/9157	

RELEASED  
06-02-07 *PH*

Qty -041	Qty -042	Qty -043	Qty -044	Part Number	Description
X				D2750-041	SKIDTUBE ASSEMBLY, LH
	X			D2750-042	SKIDTUBE ASSEMBLY, RH
		X		D2750-043	SKIDTUBE ASSEMBLY, LH
			X	D2750-044	SKIDTUBE ASSEMBLY, RH
5	5	5	5	D2648-3	WEARPAD
1	1	1	1	D2656-13	WEARSHOE
1	1	1	1	D2656-35	WEARSHOE
1	1	1	1	D2746	WEARSHOE
1	1	1	1	D2739	WEB
1	1	1	1	D2741	BLADE
8	8	8	8	D2743	SPACER
1	1	1	1	D2744	CAP
8	8	8	8	D2745	BUSHING
1				D2750-1	SKIDTUBE WELDMENT, LH
	1			D2750-2	SKIDTUBE WELDMENT, RH
		1		D2750-3	SKIDTUBE WELDMENT, LH
			1	D2750-4	SKIDTUBE WELDMENT, RH
1		1		D3488-041	BLADE FITTING, LH
	1		1	D3488-042	BLADE FITTING, RH
4	4	4	4	D3490-1	SPACER
4	4			D3490-3	SPACER
		4	4	D3490-5	SPACER
8	8	8	8	D3492-041	PLUG ASSEMBLY
8	8			D3492-043	PLUG ASSEMBLY
		8	8	D3492-045	PLUG ASSEMBLY
38	38	38	38	AN3C5A	BOLT
4	4	4	4	AN3C6A	BOLT
4	4	4	4	AN3C7A	BOLT
4	4	4	4	AN6C44A	BOLT
2	2	2	2	AN8C21A	BOLT
1	1	1	1	AN8C35A	BOLT
46	46	46	46	AN960C10L	WASHER
4	4	4	4	AN960C816L	WASHER
4	4	4	4	MS21043-6	NUT
3	3	3	3	MS21083C8	NUT
42	42	42	42	NAS1330S3KB166	INSERT
46	46	46	46	NAS1515H3L	WASHER
12	12	12	12	NAS1515H8L	WASHER

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 27958

Copyright © 1998 by DART, AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



DESIGN PH	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED PH	APPROVED PH	DRAWING NO. D2750	REV. D SHEET 2 OF 5
DATE 06.01.05		TITLE 350 SKIDTUBE ASSEMBLY	SCALE NTS

RELEASED  
06.02.07

GENERAL NOTES:

1. ALL DIMENSIONS ARE IN INCHES
2. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
3. MAKE FROM D2600-3 EXTRUSION (INITIAL LENGTH = 120.0).
4. DAMAGE TOLERANCE ON BENDING:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 12 INCHES ABOVE THE GROUND. NO GOUGING IS ACCEPTABLE IN THE FLAT PORTION OF THE TUBE. GOUGES UP TO 0.020 ARE ACCEPTABLE IN THE BENT PORTION OF THE TUBE. TUBE O.D. SHOULD BE  $3.150 \pm 0.010$  IN THE FLAT PORTION OF THE TUBE. TUBE O.D. SHOULD BE  $3.15 \pm 0.030$  IN THE BENT PORTION OF THE TUBE.
5. ALL HOLES DRILLED ON CENTERLINES EXCEPT THOSE NOTED BY SECTIONS E-E, F-F, AND R-R.
6. WELDING TO BE DONE PER DART QSI 004.
7. FINAL CONFIGURATION SHOULD HAVE THE FOLLOWING MINIMUM MECHANICAL PROPERTIES:  
MINIMUM YIELD TENSILE STRENGTH = 35 ksi  
MINIMUM ULTIMATE TENSILE STRENGTH = 38 ksi
8. FINISH:  
ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1 PRIOR TO INSTALLING D2739 WEB.  
POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED TO 1.0 ABOVE SKIDTUBE CENTER-LINE PER DART 005 4.4 (OPTIONAL).
9. INSTALL NAS1330S3KB166 INSERTS AFTER FINISH AS INDICATED IN D2750-1/-2/-3/-4 WELDING DETAIL ON PAGE 4 AND 5. DRILL 'E' SIZE HOLES ( $\emptyset 0.250$ - $\emptyset 0.257$ ) FOR WEARSHOE INSERTS. C'SINK  $\emptyset 0.391 \times 100^\circ$  AND INSTALL INSERTS
10. D3488-041 (OR D3488-042) BLADE FITTING AND AN3-5A/AN3-7A WEARSHOE SCREWS TO BE INSTALLED USING SIKAFLEX-241 (OR EQUIVALENT) SEALANT.
11. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND AFTER INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
12. APPLY A LAYER OF SIKAFLEX -241/-291 ADHESIVE BETWEEN THE BOTTOM OF THE SKIDTUBE ASSEMBLY AND THE WEARPLATES

FOR COPY  
RETURN TO  
ENGINEERING

 

Copyright © 1998 by DART AEROSPACE USA, INC.

 
UNCONTROLLED COPY

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC. WITHOUT NOTICE

WORK ORDER  
NO. 27958

9.42.07

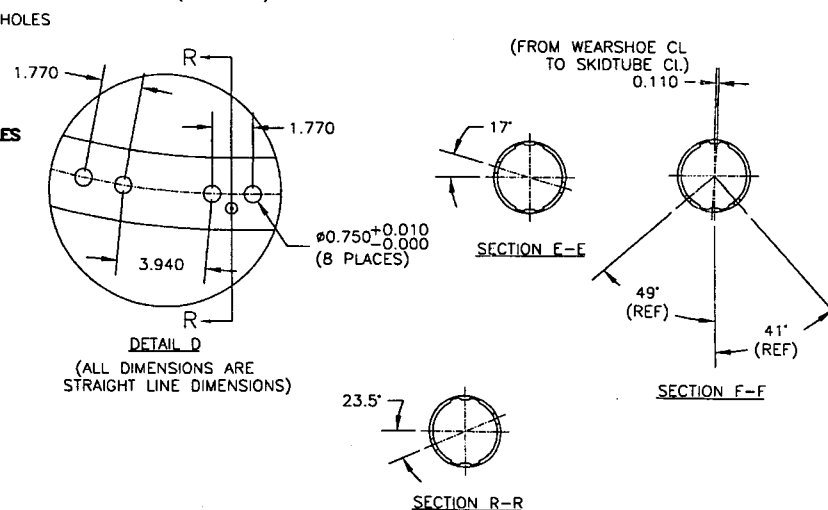


COPYRIGHT © 1988 BY DART AEROSPACE USA, INC.		DESIGN	PH	DRAWN BY	PH	 <b>DART AEROSPACE USA, INC.</b> PORT HADLOCK, WA	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED	PH	APPROVED	PH	DRAWING NO.	REV. 1
						D2750	SHEET 3 OF 3
		DATE	06.01.05	TITLE		350 SKIDTUBE ASSEMBLY	


SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 27958

**RELEASED**  
06-02-07 #


**D2750-041/-042 ASSEMBLY**  
D2750-041 SHOWN (D2750-042 OPPOSITE)

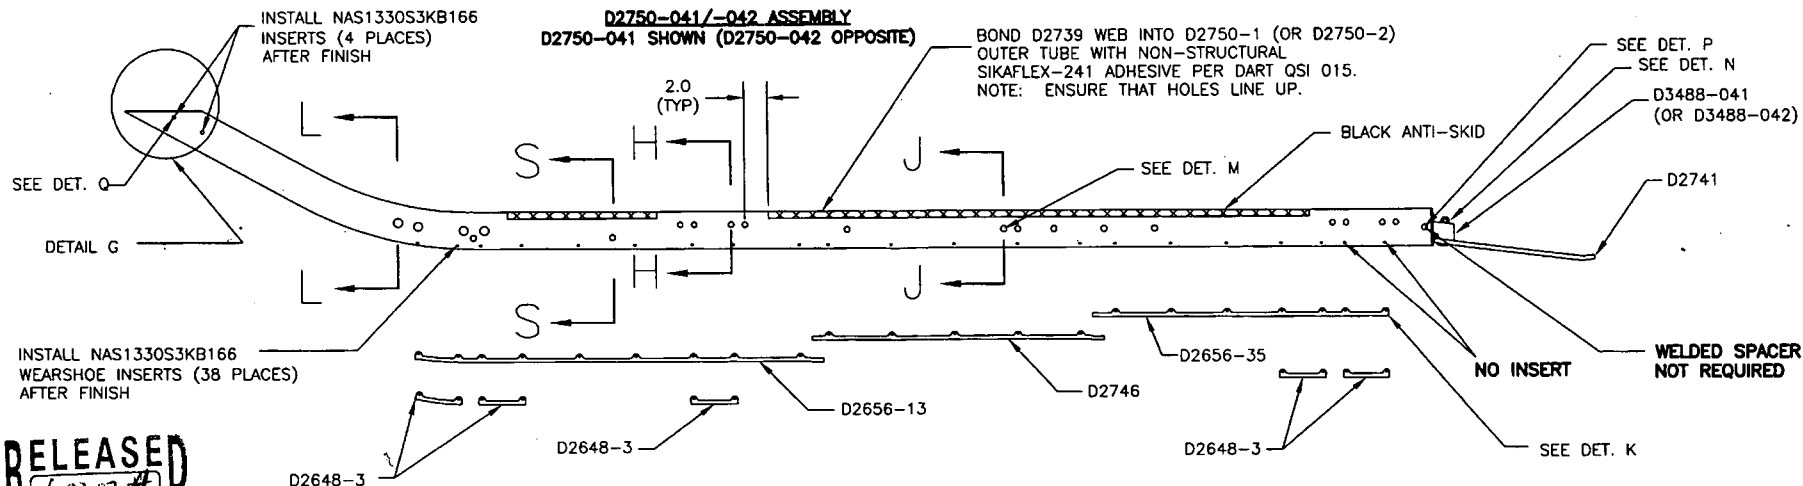


DETAIL G

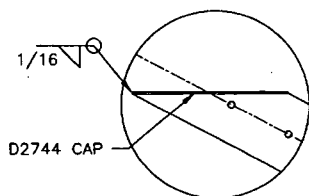

SECTION H-H D2743 SPACER (REF)

 

SECTION J-J

 

- WELDING INSTRUCTIONS**
1. CHAMFER HOLE 0.050 X 45°
  2. INSERT D2743 SPACER
  3. WELD INTO PLACE
  4. GRIND FLUSH
  5. DRILL OUT SPACER TO Ø0.484
  6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

SECTION L-L



Ø0.750 HOLES ONLY

D3492-043 PLUG ASSEMBLY

SECTION S-S



Ø0.500 HOLES ONLY

D3492-041 PLUG ASSEMBLY

- WELDING INSTRUCTIONS**
1. CHAMFER HOLE 0.050 X 45°
  2. INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES OR INSERT D3490-3 SPACER (4 PLACES) INTO Ø0.750 HOLES
  3. WELD INTO PLACE
  4. GRIND FLUSH
  5. INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER OR INSERT D3492-043 PLUG ASSEMBLY (8 PLACES) INTO D3490-3 SPACER ON BOTH ENDS


DETAIL K



USE AN3C7A BOLTS FOR INSTALLING AFT D2648-3 WEARPAD (4 PLACES)


AN3C5A BOLT (1)  
AN960JD10L WASHER (1)  
NAS1515H3L WASHER (1)  
(38 PLACES)

DETAIL P

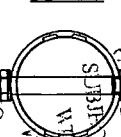

AN8C35A BOLT (1)  
AN960C816L WASHER (2)  
NAS1515H8L WASHER (2)  
MS21083C8 NUT (1)

DETAIL M

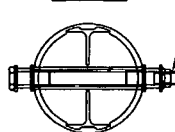


AN6-44A BOLT (1)  
D2745 BUSHING (2)  
NAS1515H8L WASHER (2)  
MS21043-6 NUT (1)  
(4 PLACES)  
**NOTE: INSTALL WASHER BETWEEN SKIDTUBE AND BUSHING**

DETAIL Q



AN3C6A BOLT (1)  
AN960C10L WASHER (1)  
NAS1515H3L WASHER (1)  
(4 PLACES)

DETAIL N

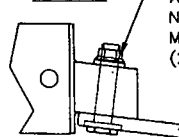

AN8C21A BOLT (1)  
AN960JD816L WASHER (1)  
NAS1515H8L WASHER (1)  
MS21083C8 NUT (1)  
(2 PLACES)

COPYRIGHT © 1996 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DESIGN	PH	DRAWN BY	PH	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	#	APPROVED	#	DRAWING NO. D2750
DATE	06.01.05	TITLE	350 SKIDTUBE ASSEMBLY	REV. D SHEET 4 OF 5 SCALE 1:20



SHD COPY  
RETURN TO  
ENGINEERING  
CONTROLLED COPY  
SUBMIT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
27958




RELEASED  
06-02-07-11

**D2750-043/-044 ASSEMBLY**  
**D2750-043 SHOWN (D2750-044 OPPOSITE)**

BOND D2739 WEB INTO D2750-3 (OR D2750-4)  
OUTER TUBE WITH NON-STRUCTURAL  
SIKAFLEX-241 ADHESIVE PER DART QSI 015.  
NOTE: ENSURE THAT HOLES LINE UP.

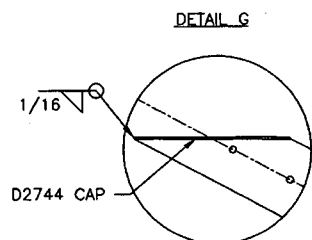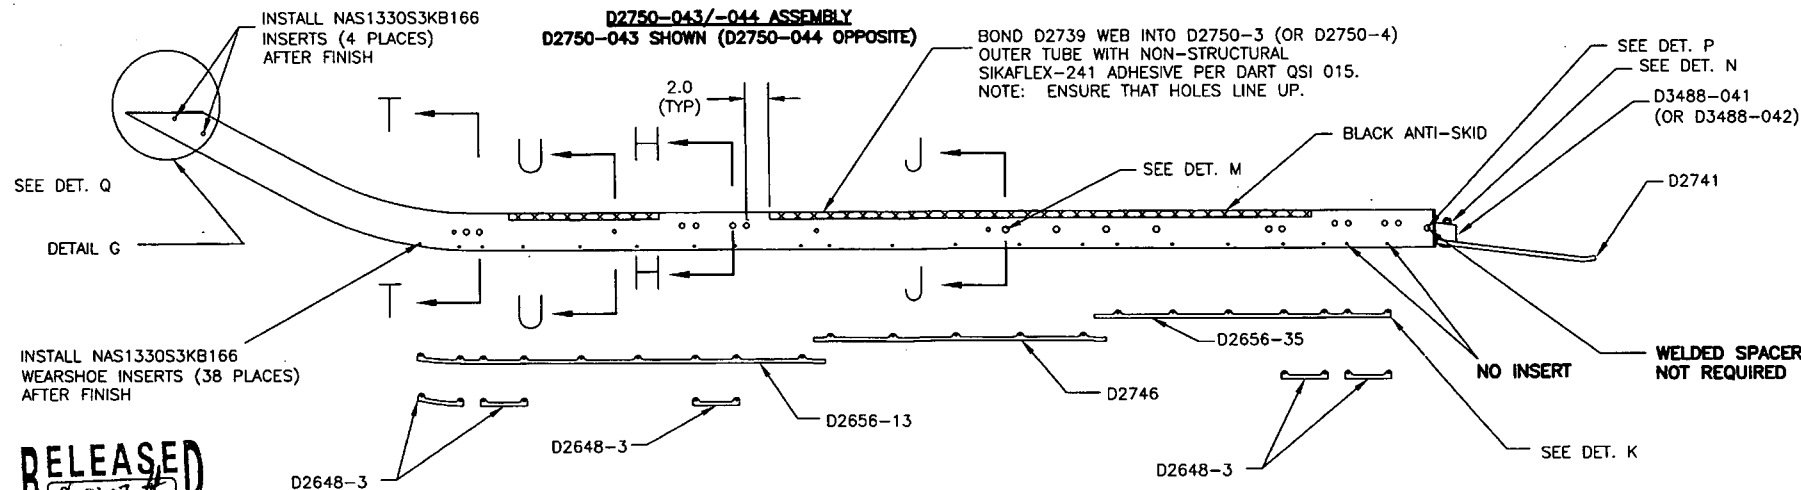

**SECTION H-H** D2743 SPACER (REF)

 

**SECTION J-J**



 
- WELDING INSTRUCTIONS**
1. CHAMFER HOLE 0.050 X 45°
  2. INSERT D2743 SPACER
  3. WELD INTO PLACE
  4. GRIND FLUSH
  5. DRILL OUT SPACER TO Ø0.484
  6. SPOT FACE Ø0.750 (SECTION J-J ONLY)

**SECTION T-T**




D3492-041 PLUG ASSEMBLY

**SECTION U-U**




D3492-045 PLUG ASSEMBLY

 


AN3C5A BOLT (1)  
AN960C10L WASHER (1)  
NAS1515H3L WASHER (1)  
(38 PLACES)

**DETAIL P**

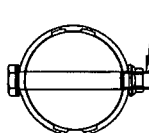


AN8C35A BOLT (1)  
AN960C816L WASHER (2)  
NAS1515H8L WASHER (2)  
MS21083C8 NUT (1)

**DETAIL M**

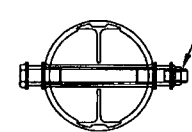


AN6C44A BOLT (1)  
D2745 BUSHING (2)  
NAS1515H8L WASHER (2)  
MS21043-6 NUT (1)  
(4 PLACES)  
**NOTE: INSTALL WASHER BETWEEN SKIDTUBE AND BUSHING**

**DETAIL Q**

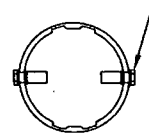

AN3C6A BOLT (1)  
AN960C10L WASHER (1)  
NAS1515H3L WASHER (1)  
(4 PLACES)

**DETAIL N**

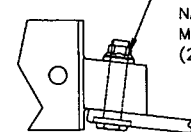

AN8C21A BOLT (1)  
AN960JD816L WASHER (1)  
NAS1515H8L WASHER (1)  
MS21083C8 NUT (1)  
(2 PLACES)

**WELDING INSTRUCTIONS**

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D3490-5 SPACER (4 PLACES) INTO Ø0.313 HOLES OR INSERT D3490-1 SPACER (4 PLACES) INTO Ø0.500 HOLES
3. WELD INTO PLACE
4. GRIND FLUSH
5. INSERT D3492-045 PLUG ASSEMBLY (8 PLACES) INTO D3490-5 SPACER OR INSERT D3492-041 PLUG ASSEMBLY (8 PLACES) INTO D3490-1 SPACER ON BOTH ENDS

COPYRIGHT © 1998 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	<b>DART</b> DART AEROSPACE USA, INC. PORT HADLOCK, VA	
CHECKED	APPROVED	PH	PH	DRAWING NO.	REV. D
DATE	06.01.05	06.01.05		D2750	SHEET 5 OF 5
				TITLE	SCALE
				350 SKIDTUBE ASSEMBLY	1:20

NO. 2758  
WORK ORDER  
SUBJECT TO ADENDMENT  
UNCONTROLLED COPY  
ENGINEERING  
RETURN TO  
SHOP COPY